PURAFIL ENVIRONMENTAL CORROSIVITY REPORT

29-Jun-2010

Company: 111389

Room Area ID: Reference #:



 Sales Order #:
 C002697

 CCC Panel #:
 P67982

 Date In:
 03-Jun-2010

 Date Out:
 17-Jun-2010

Days In Service: 14

CCC Panel # P67982

ISA Class G2
Moderate

Copper Corrosion 476 Å/30 Days

Silver Corrosion 1924 Å/30 Days

(see next page for complete analysis)

Summary for PURAFIL CCC # P67982

The electrolytic reduction analysis on Corrosion Classification Coupon #P67982 shows the presence of moderate concentrations of contaminants in the environment tested. The hydrogen sulfide level is expected to range between 3 and 10 ppb and the sulfur dioxide level between 10 and 100 ppb. The effects of corrosion are measurable and may be a factor in determining equipment reliability.

Your local representative for additional information and assistance is:

Environmental Health and Eng

117 Fourth Avenue, Needham MA 02494, USA

tminegishi@eheinc.com

Purafil, Inc. / 2654 Weaver Way, Doraville GA 30340 USA / (770) 662-8545 / (770) 263-6922 Email: purafil@purafil.com / Internet: http://www.purafil.com

Displaying Page 1 <u>Display Page 2</u>


1 of 1 6/29/2010 2:51 PM

PURAFIL CCC # P67982 Analysis Results

Corrosion Film Composition				Gold Coupon -
	30 Days	Projections <u>1 Year</u>	<u>5 Year</u>	Magnified 20x
Copper Films Cu ₂ S	345 Å	699 Å	1195 Å	
Cu ₂ O	91 Å	184 Å	315 Å	
Unknowns	40 Å	80 Å	137 Å	
Totals	476 Å	963 Å	1647 Å	
Silver Films	- 0	- 0	- 0	
AgCl	0 Å	0 Å	0 Å	
Ag ₂ S	1924 Å	23426 Å	117131 Å	
Unknowns	0 Å	0 Å	0 Å	
Totals	1924 Å	23426 Å	117131 Å	
Gold Pore Corrosion: Note: 1000 Å = 0.1 micron				

Equipment Reliability Correlation

(ISA Standard S71.04-1985 for Copper)

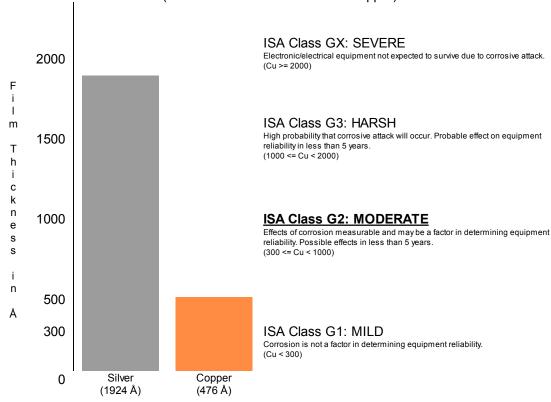

Displaying Page 2 <u>Display Page 1</u>

1 of 1 6/29/2010 2:51 PM